

# Data sheet



## I-60-D: Interior 60 minute FRR double acting doorset, single or pair

Our most popular 60 minute FRR double acting interior fire, smoke and acoustic door set, the I-60-D is available in singles or pairs. The door leaf is a solid composite timber core faced with an integral MDF layer (S-CORE). The standard door set is supplied sealer coated on both faces or you can specify a facing and/or kickplate.

- Leaf sizes up to 2030 high x 1030 wide per leaf
- Thickness 55 mm
- Weight 24.3 kg /m<sup>2</sup>
- High Acoustic values are difficult to achieve with double acting doors as it is not possible to fit drop sill seals to the door bottoms, and meeting styles present a sound path

### FACING OPTIONS

- Paint quality factory sealed
- Timber veneer full height
- High pressure laminate full height
- Vinyl to 1000 mm
- 1 mm stainless steel kickplate to 1000 mm – both sides


### LEAF EDGE DETAILS

- NZFD Bullnose (Aluminium)

### PAIR MEETING STYLES

#### Aluminium

#### *Bullnose C/C*

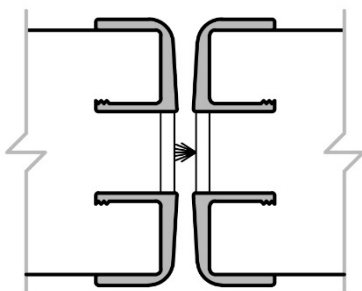


## GLAZING OPTIONS

Pyro 15 or 23 mm fire glass is used for all options. In addition to the standard options shown below, we offer bespoke designs that are available on request from our sales team. The maximum glazed area's are detailed below, subject to minimum clearances.

Section 4.16.1 of NZ Building Code Acceptable Solutions defines the maximum integrity ratings for openings in fire and smoke separations as -/60/30 across all seven Purpose Groups. For large area vision panels in doors, and for overlights and sidelights, specifying the glass at -/60/30 will reduce the weight and cost of your door or door and sidelight unit.

Call our Sales Team for more information on (09) 579-8895


### Placement dimensions

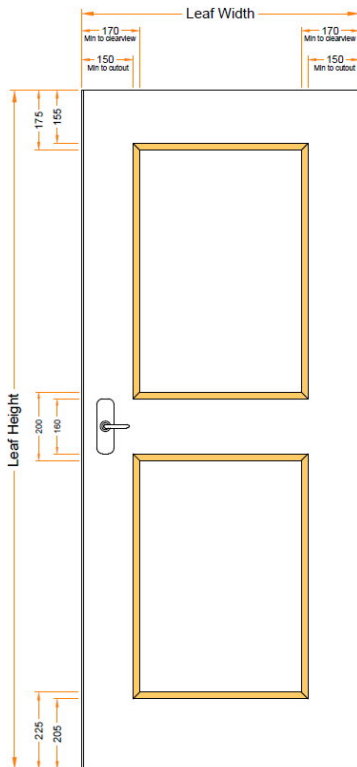


### Glass Types & size limitations

APPROVED GLASS & CLEARVIEW SIZES				
Rating	Glass	Max Height	Max Width	Max Area
NFR	10.38	2250	860	1.935 m <sup>2</sup>
-/30/-	Pyro 15	2250	860	1.935 m <sup>2</sup>
-/30/30	Pyro 15	2250	860	1.935 m <sup>2</sup>
-/60/-	Pyro 15	1830	610	0.92 m <sup>2</sup>
-/60/30	Pyro 15	1830	610	0.92 m <sup>2</sup>
-/60/60	Pyro 15	650	100	0.065 m <sup>2</sup>
-/60/60	Pyro 23	1700	300	0.51 m <sup>2</sup>
-/60/60	Pyro 23	450	450	0.2 m <sup>2</sup>
E-/60/30	Pyro 15	814	504	0.41 m <sup>2</sup>
-/240/30	Robax 6mm	600	100	0.06 m <sup>2</sup>
-/240/-	Robax 6mm	750	150	0.11 m <sup>2</sup>

### Some possible design idea's

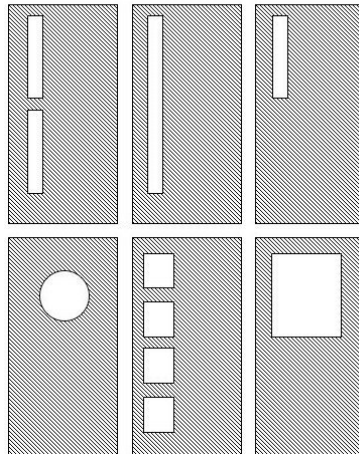

### Gun slot design (most economical)

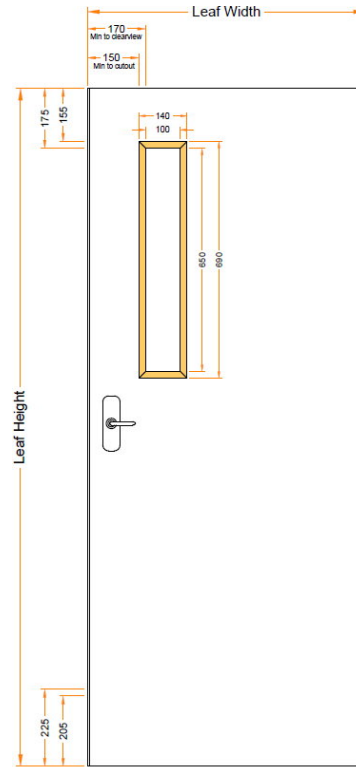


## GLAZING BEAD OPTIONS


### Square (standard)

- No additional charge
- Includes optional aluminium overcap

*Square Bead with Lip*

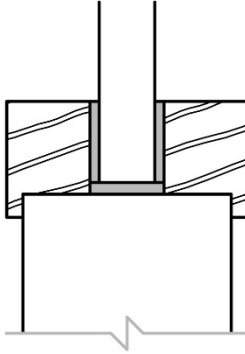


*Aluminium Bead*

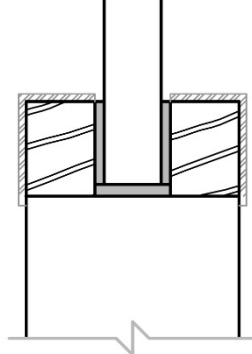

### Bevel (previous standard)

- Optional
- No aluminium cap option

*Bevel Bead with Lip*

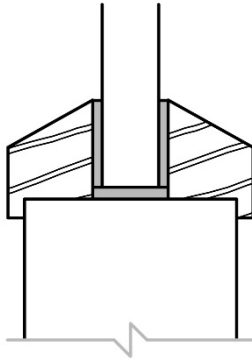


## JAMB TYPES AND PROFILES

Hardwood timber, 32 mm jambs, 60 mm head standard (types 1, 2 & 3), min jamb width or 1.6 mm electrogalv steel (type 8), paint quality or powdercoat options available


**T1 – Timber**

**T2 – Timber**

**T3 – Timber**

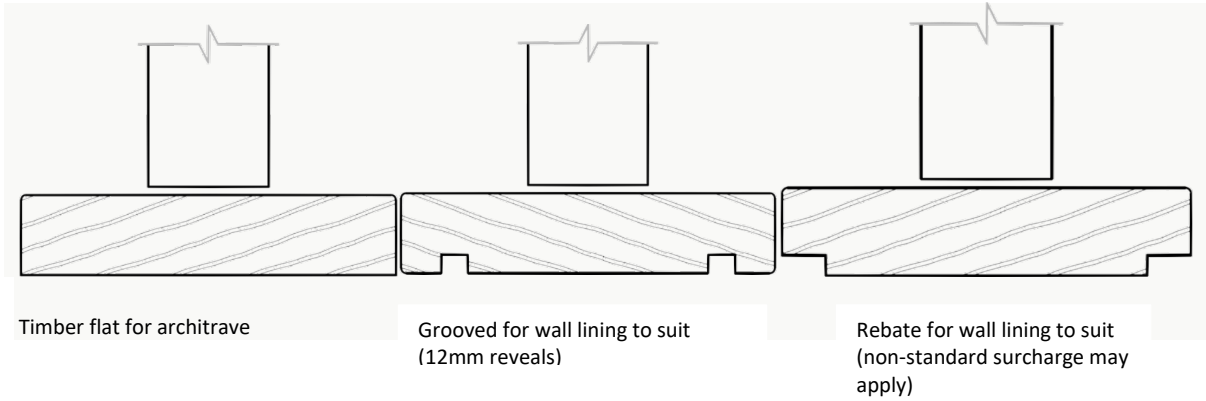


**T8 – Steel**

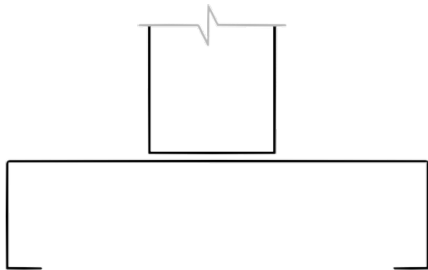

## SIDELIGHTS AND OVERLIGHTS

The I-60-D is available in a range of sidelight and overlight combinations that are generally made to order. If you require a sidelight or overlight, please contact a member of our sales team to discuss and confirm specific design and pricing details.

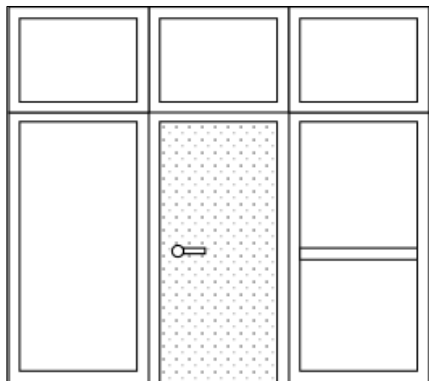

- Maximum overall combined height 2700mm.
- Perimeter timber 45 mm and transom midrail 60 mm.
- No limit to overall width.
- Each module is limited by weight, transport and on site handling capabilities.
- Max door height 2030 mm
- Sidelights with optional mid rail – consider manifestation needs

## APPROVED HARDWARE

The minimum requirement is for a fire door to be self-closing and self-latching. With our double acting doors the closers are the pivot mechanisms, which are already fitted. Hardware must be selected from NZ Fire Doors' Approved Hardware list from the column '60 min'. Fitting any hardware that inhibits self-closing or self-latching is not approved by NZS 4520

**IMPORTANT:** Fitting untested or inappropriate hardware may affect the performance of the door and will void the warranty.

See technical compliance statement